

~~SECRET~~

CMCC 274X5.32

Copy 3 of 4

1 October 1958

To: WRSP-2, Att: Commo

From: R-W, [REDACTED]

Info: WRSP-3

Headquarters, 25X1A

Ref: Detachment B Report dated 22 August 1958,
Subject: "Elint Activities, 1-31 July 1958"Paragraph numbers correspond to those in the
referenced report.

25X1A

1.b. The 100 Subminax cables which were shipped to [REDACTED] are presumed lost. An additional 200 cables are on order, and it is expected these will be available for shipment some time this week.

1.g. It is possible that failure of the recorder was due to separation of the connectors in flight. This problem has been encountered several times previously. A Field Service Bulletin and Modification Kit are in preparation which will provide positive locking of Winchester connectors P702 and J702. The kits and Service Bulletins should be ready for shipment by the end of this week.

2. It is possible that the problem with the replacement recorder motors was due to dirty commutators. We have found that the commutators require cleaning each 15 hours of operating time to ensure proper operation of the governor. We are taking steps at the plant to ensure that the motors are properly cleaned before shipment to the field. In addition, we would appreciate your tagging one of the defective motors and forwarding it to the depot for return to the factory so that it can be inspected for other possible defects.

SJ:hcp

25X1A

DOCUMENT NO. _____
NO CHANGE IN CLASS. ☐
CLASSIFIED
CLASS. CHANGED TO: TS S (C) 2011
NEXT REVIEW DATE: _____
AUTH: HR 70-2
DATE: 12/11/81 REVIEWER: 037169

~~SECRET~~